


C Male Connector Clamp/Solder Attachment for RG213, RG214,  
RG8, RG9, RG11, RG225, RG393, RG144, RG216, RG215, High  
Voltage

**ASSEMBLY PROCEDURES**

1. SLIDE CLAMP NUT (1) & GASKET (2)  
OVER CABLE. STRIP CABLE AS SHOWN. DO  
NOT NICK BRAID WHILE CUTTING JACKET.  
TAPER END OF BRAID TO PERMIT ASSEMBLY  
OF BRAID CLAMP (3) SLIDE BRAID CLAMP(3)  
OVER BRAID & SEAT AGAINST CABLE.

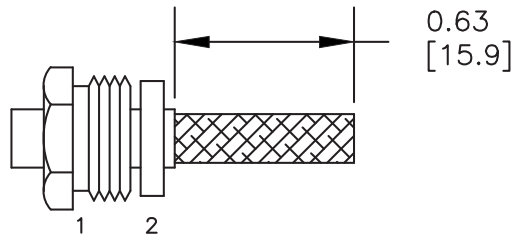

2. FORM BRAID OVER CLAMP NUT (3). TRIM  
BRAID BACK TO SHOULDER. CUT DIELECTRIC  
TO DIMENSION SHOWN. DO NOT NICK CENTER  
CONDUCTOR. SOLDER CONTACT TO CENTER  
CONDUCTOR. REMOVE EXCESS SOLDER. DO  
NOT OVER HEAT DIELECTRIC. INSERT CABLE  
ASSEMBLY INTO BODY & TIGHTEN.

