


75 Ohm SMB Plug Connector Clamp/Solder Attachment for RG59, RG62, RG71

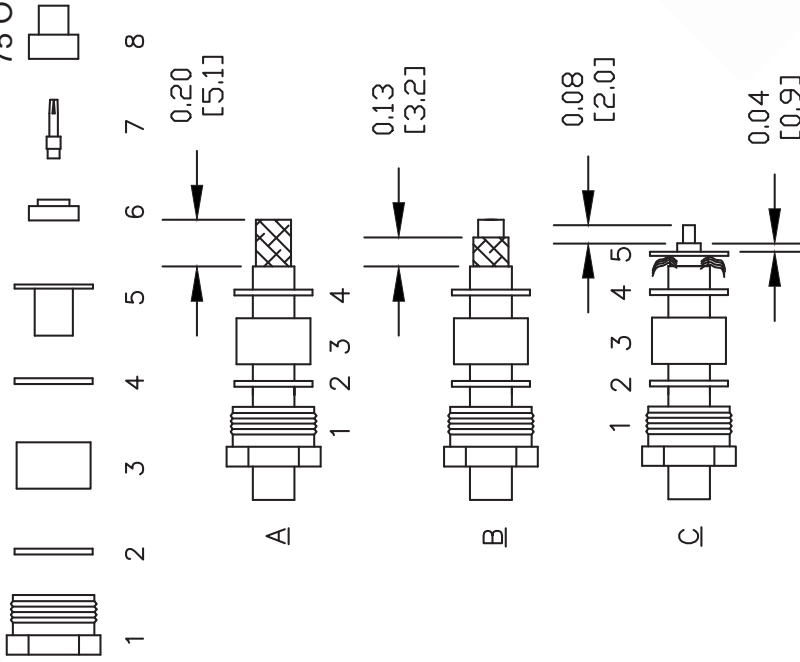

STRIPPING DIMENSIONS

ASSEMBLY PROCEDURES

1. SLIDE CLAMP NUT (1), WASHER (2), GASKET (3) & WASHER (4) OVER CABLE. STRIP CABLE AS SHOWN IN A & B. FLAIR BRAID.
2. SLIDE EXTENSION (5) BETWEEN BRAID & DIELECTRIC TILL IT IS RESTING AGAINST JACKET. TRIM BRAID BACK TO SHOULDERS OF EXTENSION (5). STRIP CABLE AS SHOWN IN C. SLIDE INSULATOR (6) OVER CENTER CONDUCTOR. SOLDER CONTACT (7) TO CENTER CONDUCTOR. SLIDE INSULATOR (8) OVER CONTACT (7).
3. THEN SLIDE ASSEMBLY FORWARD INTO BODY & TIGHTEN.

DWG TITLE

**ET10214**

NOTES:  
 1. UNLESS OTHERWISE SPECIFIED ALL DIMENSIONS ARE NOMINAL.  
 2. ALL SPECIFICATIONS ARE SUBJECT TO CHANGE WITHOUT NOTICE AT ANY TIME.  
 3. DIMENSIONS ARE IN INCHES (mm).  
 4. FITS MIL-C-17 AND EQUIVALENT CABLES.

WEBSITE: [www.ebeestock.com](http://www.ebeestock.com)  
 EMAIL: [sales@ebeestock.com](mailto:sales@ebeestock.com)

8TH FLOOR, BUILDING 1, YONGFU SCIENCE AND TECHNOLOGY CENTER INDUSTRIAL PARK, NANZHA DISTRICT 5, HUMEN, 523900, DONGGUAN, GUANGDONG, CHINA



REV. -	FSCM NO. 53919	CAD FILE 042309	SCALE N/A	SIZE A	147
--------	----------------	-----------------	-----------	--------	-----