

MATERIALS		1
BODY	BRASS NICKEL PLATED	
CONTACT	GOLD PLATED	
INSULATOR	PTFE	



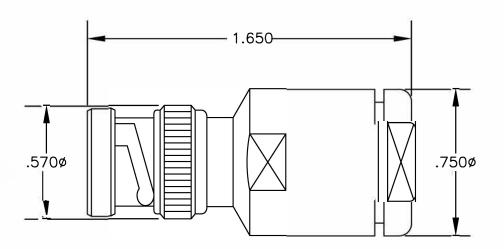


## ASSEMBLY PROCEDURES

1. SLIDE CLAMP NUT (1) & GASKET (2) OVER CABLE. STRIP CABLE AS SHOWN. DO NOT NICK BRAID WHILE CUTTING JACKET. TAPER END OF BRAID TO PERMIT ASSEMBLY OF BRAID CLAMP (3) SLIDE BRAID CLAMP(3) OVER BRAID & SEAT AGAINST JACKET.



2. FORM BRAID OVER CLAMP NUT (3). TRIM BRAID BACK TO SHOULDER. CUT DIELECTRIC TO DIMENSION SHOWN. DO NOT NICK CENTER CONDUCTOR. SOLDER CONTACT TO CENTER CONDUCTOR. REMOVE EXCESS SOLDER. DO NOT OVER HEAT DIELECTRIC. INSERT CABLE ASSEMBLY INTO BODY &

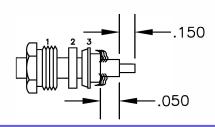

- \* PE-C Series is a functionally equivalent to Times Microwave LMR series
- \*\* LMR<sup>®</sup> is a registered trademark of Times Microwave



8TH FLOOR, BUILDING 1, YONGFU SCIENCE AND TECHNOLOGY Center industrial park, Nanzha district 5, Humen,523900,Dong Guan, Guangdong, China



WEBSITE: www.ebeestock.com EMAIL: sales@ebeestock.com

**E**T1**0**379

BNC MALE, CLAMP ATTACHMENT FOR PE-C300\* & LMR300\*\*

REV. A FSCM NO. 53919

CAD FILE 050609

SCALE N/A SIZE A 127

## OTFS:

- 1. UNLESS OTHERWISE SPECIFIED ALL DIMENSIONS ARE NOMINAL.
- 2. ALL SPECIFICATIONS ARE SUBJECT TO CHANGE WITHOUT NOTICE AT ANY TIME.
  3. DIMENSIONS ARE IN INCHES.